



قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

# Study of Air Pollutants Levels Resulted from Stacks and Production Operation in Indoor and Outdoor Environment EGYPT LECICO COMPANY (KHORSHED)

Research Team
Prof. Dr. Madbouli HamedNoweir

Prof. Dr. Kamal HamedNoweir Dr. Fadia Ahmed El-Marakby Prof. Dr. Ahmed Ibrahim Issa Dr. GehanRaafat Mohamed







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

### 1. INTRODUCTION

Lecico Company requested the Occupational Health and Air Pollution Research Center – High Institute of Public Health (HIPH) – University of Alexandria to assess exposure of workers to physical factors and air pollutants levels at their workplaces in the company, to assess the air pollutant levels emitted from the company to the outdoor atmosphere and to evaluate the stack emissions from different departments in the company.

The highly developing awareness about environmental issues side by side with official seriousness concerning the restrict application of Egyptian Environmental Law No. 4-1994 and decision of Minister of Manpower and Immigration No 211-2003 make environmental assessment a necessity.

The Lisico Company has started the environmental assessment as early as its construction date. The management convince of the importance of environmental protection has made the company one of the pioneers in this aspect.

The research team of the Occupational Health and Air Pollution Research center makes this study during the period from 31 May to 2 June 2016.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

#### 1. Potential Hazards

A variety of health hazards to which workers in LecicoCompanyare exposed. These hazards include:

- Exposure to *Total Suspended Particulates* During handling and weighing of raw materials, and during mixing, grinding, and component preparation.
- Exposure to Heat.
- Exposure to Noise
- Exposure to Lighting

#### 1.1. Total and Respirable Particulates (TSP& PM10)

The term TSP refers to a wide range of finely divided solids or liquids dispersed into the air from combustion processes (heating, and power generation), industrial activities, and natural sources. Total suspended particulates range in size from 0.1 up to 10µm in diameter.

Exposure to TSP is through inhalation, in which dust particles are carried with air stream into the lungs and the majority of them being either exhaled or eliminated by means of the lung clearance mechanism. A small amount of these particles may be deposited in the lungs, depending on their size. Medical research has shown that particles of 1-5 µm can remain in the alveolar passages (respirable dust), while larger particles are retained by the mucous membrane of the nose, the throat, the trachea, and the bronchi, and are eliminated by the mechanism. Smaller Particles (<0.1





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

µm) behave as colloids, of which a typical example is smoke. Smaller fractions of the particles are transported by lymphatic system after penetrating the interstitial tissue.

#### 1.2. Heat Stress

The first response of exposure to heat is a sensation of discomfort. Inefficiency in the performance of physical and nonphysical tasks, an increased propensity to minor accidents and changes in the emotional tone of workers are found in association with these changes in sensation and body temperature.

If combination of workload and environmental heat is so great that thermal balance cannot be maintained, workers will become susceptible to heat exhaustion, rash, cramp, and stroke.

# 1.3. Equivalent Noise

Exposure to noise may lead to psychological and physiological effects. The psychological effects include annoyance, disruption of concentration, sleep or relaxation, and interference with communication that may lead to absenteeism, and accidents. The physiological effects are primarily noise induced hearing loss, aural pain, Nausea, and reduced muscular control.

# 1.4. Lighting

Exposure to unsuitable lighting leads to negative effects on vision, in addition to loss of concentration, characteristic headsche.





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

### 2. SCOPE

Three different locations were assessed in this study:

- Indoor work environment, the levels of which were compared with the TLV of the Egyptian Environmental Law No. 4-1994amended by law No 9-2009 and its executive law of the Prime minister No 1095-2011 and decision of the Minister of Manpower and Immigration No. 211 - 2003.
- Stack emissions, the levels of which were compared with the source emission guidelines of the Egyptian Environmental Law No. 4-1994 amended by law No 9-2009 and its executive law of the Prime minister No. 710-2012.
- Outdoor work environment, the levels of which were compared with the air quality guidelines of the Egyptian Environmental Law No. 4-1994 amended by law No 9-2009 and its executive law of the Prime minister No 1095-2011.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء


# 3. WORK ENVIRONMENT EVALUATION

# 3.1. Indoor Sampling


# 3.1.1. Total and Respirable Suspended Particulates

Inside the LisicoCompany, different locations were selected for sampling of total and Respirable suspended particulates. The sampling procedures included stationary samples that are collected at fixed places representing all work conditions. The sampling train consists of pump, filter holder and in case of Respirable particulates a cycloneis added as illustrated in figure (1). The sampling train must then be calibrated using wet gas meter. The stationary sampling system was at height of about 1.5 meter to represent the breathing zone. Samples were collected for 2-3 hours using membrane filter. The concentration of TSP was determined gravimetrically in mg/m<sup>3</sup>.



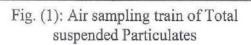



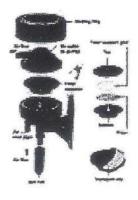

Air sampling train of Respirable Particulate Matter





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

#### 3.1.2. Heat Stress

Heat stress index (Wet Bulb Globe Temperature WBGT) has been determined at different locations Using WBGT- Meter shown in figure (3).

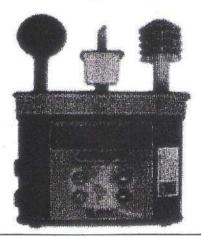


Figure (3): Wet Bulb Globe Thermometer

# 3.1.3. Equivalent Noise

Equivalent Noise levels were determined in Decibel dB(A) at different locations using pre-calibrated sound level meter at 114 dB(A) as indicated in figure (4).



Calibrated Sound Level Meter At 114 dB(A)





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

### 3.1.4. Lighting

The lighting in various departments is measured using Lux-meter shown in figure (5).



Figure (5): Luxmeter

# 3.2. Stack Emission Evaluation

Stack emissions were measured using Emission Gas Analyzer illustrated in

figure(6)

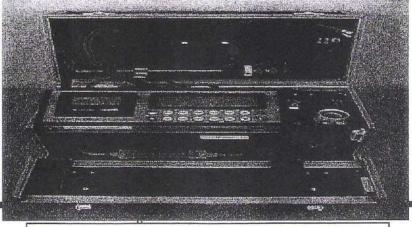


Figure (6): Emission Gas Analyzer

3 Ibrahim Sherief Street – MoustafaKamel-Alexandria Tel: 03/5426525 Fax: 03/5426525 or 03/4288436

Web site: <a href="http://www.hiph-egypt.net/get\_sub\_detailed-31-139-26-pg.html">http://www.hiph-egypt.net/get\_sub\_detailed-31-139-26-pg.html</a>

E-mail: niosh\_hiph@yahoo.com





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

# 3.3. Ambient Air Sampling

Levels of different ambient air pollutants associated with Lisico Company were assessed during the period of study to study the effect of these levels on the neighboring areas. In addition, noise levels and heat stress index were measured at different locations outside the Lisico Company.

Four locations were selected around the company as air sampling stations. These stations represent the four main directions. Samples of TSP were collected for 24 hours per day during the period of the study. Levels of CO gas were measured for only one hour per day at each sampling station.

# 3.3.1. Total Suspended Particulates

# 3.3.1.1. Sampling and Analysis

The recommended instrument for sampling large volumes of air for airborne particulates is high volume sampler shown in figure (7). It consists of an inlet, filter holder, an air mover, a flow controller, and a timer. Air is drawn through a weighed  $8\times10$  inch filter (usually glass fiber filter) at a flow rate about  $40 \text{ ft}^3/\text{min}$ . The volume of air filtered is taken as the product of the sampling time and average flow rate. Concentration of airborne dust is determined gravimetrically in  $\mu g/m^3$ .





قسمالصحة المهنية وتلوث الهواء المعهد العالى للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

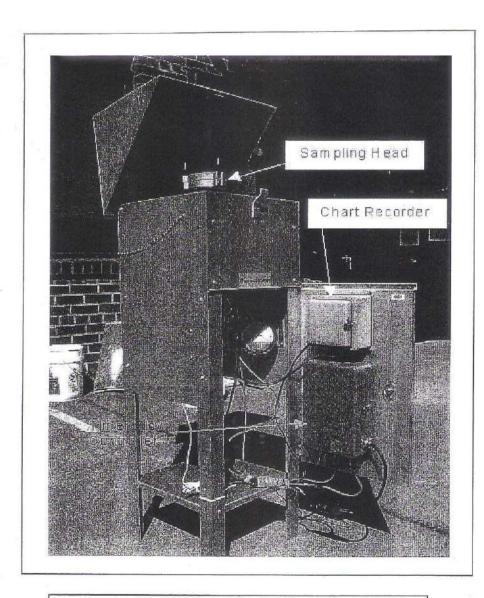


Figure (7): High Volume Sampler

3 Ibrahim Sherief Street - Moustafa Kamel-Alexand 1241, Tel: 03/5426525 Fax: 03/5426525 or 03/4288436 Web site: <a href="http://www.hiph-egypt.net/get\_sub\_detailed-31-139-26-pg.html">http://www.hiph-egypt.net/get\_sub\_detailed-31-139-26-pg.html</a>
E-mail: <a href="mailto:niosh\_hiph@yahoo.com">niosh\_hiph@yahoo.com</a>





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

#### **RESULTS & DISCUSSION**

#### 1. Work Environment evaluation

1.1. Noise levels using Sound Level Meter calibrated at 114 dB and Wet Bulb at different departments of Sanitary Production

a) Equivalent noise levels at preparation, pouring, gypsum, glaze, spraying, sorting and models

| Departments of the Sanitary Plant | Equivalent noise Level (dB) | TLV according to Egyptian Environmental Law No. 4 for 1994 In case of 8 continuous working hours |
|-----------------------------------|-----------------------------|--|
| Preparing                         | 81.1-82.0                   |  |
| Pouring                           | 76.7-77.9                   |  |
| Gypsum                            | 72.5-74.0                   |  |
| Glaze                             | 84.7-85,2                   | 90.0 dB  |
| Spraying                          | 83.1-84.3                   |  |
| Sorting                           | 79.4-80.8                   |  |
| Models                            | 65.9-67.0                   |  |

b) Equivalent Noise levels at spraying department

| De                                       | epartments of the Sanitary Plant         | Equivalent<br>Noise Level<br>(dB) | Nature of<br>Exposure                     | TLV according<br>to Egyptian<br>Environmental<br>Law No. 4 for<br>1994 amended by<br>Law No. 9-2009 |
|--|--|-----------------------------------|---|---|
| ying                                     | Spraying 1(15rooms) without air spraying | seconds every                     |   |   |
| in spra<br>ents                          | Spraying 1(15rooms) with air spraying    | 97.2-98.1                         | 5 minutes<br>(totally 50<br>minutes in    |   |
| l rooms in sp<br>departments             | Spraying 2(9rooms) without air spraying  | 93.2-94.0                         | the shift<br>period of 8<br>hours).       | 99.0dB  |
| Control rooms in spraying<br>departments | Spraying 2(9rooms) with air spraying     | 98.1-99.5                         | Moreover, all<br>workers use<br>ear muffs |   |

3 Ibrahim Sherief Street - MoustafaKamel-Alexandria Tel: 03/5426525 Fax: 03/5426525 or 03/4288436 Web site: http://www.hiph-egypt.net/get\_sub\_detailed-31-139-26-pg.html

E-mail: niosh hiph@yahoo.com





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

It is clear from the two tables that the measured noise levels were lower than the threshold limit values- time weighted average, hence they are safe.

#### c) Heat stress index at production departments in Sanitary Plant

| Departments of the  |             | Heat Stre                |   |  |
|---------------------|-------------|--------------------------|---|--|
| Sanitary Plant      | Heat stress | Nature of<br>Work        | Threshold Limit Value<br>According to Law No.4,<br>1994 amended by Law<br>No 9-2009 |  |
| Preparing           | 33.6**      |                          |   |  |
| Pouring             | 32.6**      |                          |   |  |
| Gypsum              | 30.6**      | Average work             |   |  |
| Glaze               | 28.5        | with 50%<br>work and 50% | 29.4°C  |  |
| Spraying<br>Sorting | 31.5**      | breaks                   |   |  |
|                     | 31.1**      |                          |   |  |
| Models              | 31.5**      |                          |   |  |

<sup>\*</sup>TLV-TWA according to Annex No 9 of the Executive Law No 1095-2011 of the Egyptian environmental Law No 9-2009

It is obvious from the table that the measured levels of wet bulb globe temperature were higher than the threshold limit values-time weighted average at preparing, pouring, gypsum, spraying, sorting, and models. So Exhaust fans are needed to increase air velocity, and evaporation. Moreover, suction fans are recommended to reduce the relative humidity.

At the glaze department, the WBGT is lower than the TLV-TWA. So the exposure is safe and no occupational hazards are recommended.

<sup>\*\*</sup> The measured WBGT > TLV-TWA





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

d) Lighting at production departments in Sanitary Plant

|                                   | Light Intensity Levels (Lux) |  |   |  |
|-----------------------------------|------------------------------|--|---|--|
| Departments of the sanitary plant | Lighting<br>Level**          | Required Accuracy                            | TLV according<br>to decision No<br>211-2003 |  |
| Preparing                         | 332.0                        |  | 323 Lux                                     |  |
| Pouring                           | 50.0**                       |  |   |  |
| Gypsum                            | 104.0**                      | Tasks require average accuracy in details    |   |  |
| Glaze                             | 1783.0                       |  |   |  |
| Spraying                          | 153.0**                      |  |   |  |
| Sorting                           | 1393.0                       | Tasks require<br>high accuracy in<br>details | 1076  |  |
| Models                            | 741.0                        | Tasks require accuracy in details            | 538   |  |

<sup>\* \*</sup>The levels of light intensity must not be less than the maximum permissible limit

As clear in the tablethe measured levels of lighting were lower than the threshold limit values of the decision of Minister of Man Power & Immigration No. 211-2003at pouring, gypsum, and spraying department. Hence, it is necessary to increase the lighting intensities at these departments. While at preparing, glaze, sorting, and models; the levels were higher than the TLV.So, the levels are safe and no health effects are expected.





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

e. Total and Respirable airborne particulates at indoor work environment of different

production departments in the Sanitary Plant

| Departments of Sanitary   | Concentration of T<br>Particulat | otal and Respirable<br>tes (mg/m³) |
|---|----------------------------------|------------------------------------|
| Factory   | TSP                              | RSP                                |
| Preparation   | 0.4                              | ND**                               |
| Pouring   | 1.5                              | 1.0                                |
| Gypsum  | 1.4                              | 1.0                                |
| Glaze   | 0.5                              | ND**                               |
| Spraying  | 1.0                              | 0.5                                |
| Sorting   | 0.3                              | ND**                               |
| Models  | 0.3                              | ND**                               |
| Maximum Permissible Level<br>According to Law No.4, 1994<br>amended by Law No. 9-2009 | 10.00                            | 3.00                               |

\*Threshold Limit Values-time weighted average according to Egyptian Environmental Law No 4-1994 amended by Law No 9-2009, and Annex 8 of its executive law No 1095-2011.

\*\* The measured level is lower than the lower detectable limit of the measurement method.

According to the Egyptian Environmental Law No. 4 for 1994 amended by Law No. 9-2009 and the Annex 8 of its executive rule No 1095-2011, all levels of total and respirable particulate matter were below the Threshold Limit Values (TLVs) and do not cause any occupational adverse health effects for the exposed workers.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

#### 1.2. Tile Production Plant

a. Equivalent noise level using Sound Level Meter calibrated at 114 dB at different departments of Tile Production.

| Department at the tile plant | Equivalent Noise Level (dB) |           |  |  |  |
|------------------------------|-----------------------------|-----------|--|--|--|
|                              | T2                          | Т4        | Duration of<br>Exposure                  | TLV according to<br>Environmental Law<br>No.4-1994amended by<br>Law No 9-2009* |  |
| 1. Preparation               | 88.6-89.0                   | 86.8-87.7 | Continuous<br>exposure for<br>8hours/day | -1   |  |
| 2. Glaze                     | 85.1-86.5                   | 90.0      |  |  |  |
| 3. Décor                     | 84.8-85.0                   | 88.6      |  | 90.0   |  |
| 4. Sorting                   | 85.6-90.0                   | 80.4      |  | 90.0   |  |
| 5. Ovens                     | 82.7-83.3                   | 86.2      |  |  |  |
| 6. Pistons                   | 84.7-85.1                   | 90.0      |  | •  |  |

<sup>\*</sup> Permissible limits of equivalent noise level according to annex 7 table-2 of the Executive regulations No 1095-2011 and 710-2012 of the Egyptian Environmental law No 4-1994 amended by law No 9-2009

It is clear from the table that the measured levels of equivalent noise were lower than the threshold limit values-time weighted average. So, they are safe and no health effects are expected.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

b) Heat stress index using WBGT index at Tile Production Sectors

|                                  |        | Heat st | ress index (WBC       | GT)  |
|----------------------------------|--------|---------|-----------------------|--|
| Departments of the Tile<br>Plant | Т2     | T4      | Nature of<br>Work     | Threshold Limit Value According to Law No.4, 1994 amended by Law No 9-2009 |
| 1. Preparation                   | 29.0   | 29.3    |                       |  |
| 2. Glaze                         | 28.1   | 26.0    | Average               |  |
| 3. Décor                         | 29.2   | 27.2    | work with<br>50% work | 29.4   |
| 4. Sorting                       | 29.2   | 27.6    | and 50%<br>breaks     | 2211   |
| 5. Ovens                         | 27.5   | 27.6    |                       |  |
| 6. Pistons                       | 29.9** | 26.1    |                       |  |

<sup>\*</sup> Permissible limits of equivalent noise level according to annex 9 of the Executive regulations No 1095-2011 and 710-2012 of the Egyptian Environmental law No 4-1994 amended by law No 9-2009

It is obvious from the table that the wet bulb globe temperature at the pistons' department is higher than the permissible limits. So, these levels must be reduced by using exhaust fans to increase air velocity and evaporation; and using suction fans to reduce the relative humidity.

At the other departments the measured levels lower than the threshold limit values-time weighted average. So the levels are safe and no health effects are expected.





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

#### c) Lighting levels at production Sectors using Lux meter at the Tile Production Plant

|                         | Light Intensity Level (Lux) |       |  |                                       |  |  |
|-------------------------|-----------------------------|-------|--|---------------------------------------|--|--|
| Departments of the Tile |                             |       |  |                                       |  |  |
| Plant                   | T2                          | T4    | Required Accuracy                      | TLV according to decision No 211-2003 |  |  |
| 1. Preparation          | 316.0                       | 326.0 |  | 323                                   |  |  |
| 2. Glaze                | 1209.0                      | 840.0 | Tasks require average accuracy         |                                       |  |  |
| 3. Décor                | 1136.0                      | 325.0 |  |                                       |  |  |
| 4. Sorting              | 260.0**                     | 760.0 | Tasks require high accuracy in details | 753                                   |  |  |
| 5. Ovens                | 150.0**                     | 620.0 | Accuracy in details                    | 538                                   |  |  |
| 6. Pistons              | 292.0**                     | 491.0 | Tasks require average accuracy         | 323                                   |  |  |

\*The levels of light intensity must not be less than the permissible limit according to table No 6 of the decision of Minister of Manpower and Immigration No 211-2003

As clear in the tablethe lighting levels were higherthan the permissible limit at all T4 department and at the preparation, glaze, and décor of T2. So, it is safe and no health effects are expected in these departments. At sorting, ovens, and pistons of T2 the measured were lower than the permissible limits, So It is important to increase lighting at these department.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

d) Total and Respirable airborne particulates at indoor work environment of the Tile

| Departments of Tile plant   |               | Concentration of Total and Respirable Particulates (mg/m <sup>3</sup> ) |      |
|---|---------------|---|------|
|   |               | TSP   | RSP  |
|   | PreparationT2 | 1.0   | 1.0  |
|   | T4            | 1.5   | 0.6  |
|   | Décor T2      | 0.3   | ND** |
|   | T4            | 0.6   | 0.5  |
|   | Glaze T2      | 1.3   | 1.0  |
|   | T4            | 1.7   | 1.5  |
| Tile  | PressingT2    | 0.5   | ND** |
| I   | T4            | 1.5   | 1.0  |
|   | Sorting T2    | 1.6   | 1.5  |
|   | T4            | 1.5   | 1.0  |
|   | Kilns T2      | 1.5   | 0.5  |
|   | T4            | 0.5   | 0.5  |
| 3 <sup>rd</sup> Fire  |               | 1.0   | ND** |
| Maximum Permissible Level According to Law No.4, 1994 amended by Law No. 9-2009 |               | 10.00   | 3.00 |

<sup>\*</sup> Permissible limits of equivalent noise level according to annex 8 of the Executive regulations No 1095-2011 and 710-2012 of the Egyptian Environmental law No 4-1994 amended by law No 9-2009

According to the Egyptian Environmental Law No. 4 for 1994 amended by Law No. 9-2009 and the Annex 8 of its Executive law No 1095-2011, all levels of total and respirable particulate matter were below the Threshold Limit Values (TLVs) and do not cause any occupational adverse health effects for the exposed workers.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

#### 1.3- Fret Plant

a. Equivalent noise level using Sound Level Meter calibrated at 114 dB at different departments of Fret Plant.

| Department at the<br>Fret plant | Equivalent Noise<br>Level (dB) | Duration of<br>Exposure   | TLV according to<br>Environmental<br>Law No.4-<br>1994amended by<br>Law No 9-2009* |
|---------------------------------|--------------------------------|---------------------------|--|
| Supervisors' room               | 83.2-84.4                      | Exposure                  |  |
| Preparation                     | 71.8-79.2                      | period not<br>more than 4 | 93.0   |
| Control room                    | 78.2-80.1                      | hours/day                 | N (K)  |

<sup>\*</sup> Permissible limits of equivalent noise level according to annex 7 table-2 of the Executive regulations No 1095-2011 and 710-2012 of the Egyptian Environmental law No 4-1994 amended by law No 9-2009

It is clear from the table that the measured levels of equivalent noise were lower than the threshold limit values-time weighted average. So, they are safe and no health effects are expected.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

b) Heat stress index using WBGT index at production Sectors of the Fret Plant

| Department at the<br>Fret plant | Heat stress index<br>(WBGT)<br>°C | Nature of<br>Work    | Threshold Limit<br>Value According<br>to Law No.4, 1994<br>amended by Law<br>No 9-2009 |  |
|---------------------------------|-----------------------------------|----------------------|--|--|
| Supervisors' room               | 27.4                              | Average<br>work with |  |  |
| Preparation                     | 27.6                              | 50% work             | 29.4   |  |
| Control room                    | 26.5                              | breaks               | Lagr.  |  |

<sup>\*</sup> Permissible limits of equivalent noise level according to annex 9 of the Executive regulations No 1095-2011 and 710-2012 of the Egyptian Environmental law No 4-1994 amended by law No 9-2009

It is obvious from the table that the measured levels lower than the threshold limit values-time weighted average. So, the levels are safe and no health effects are expected.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

# c) Lighting levels at production Sectors using Lux meter at the Fret Plant

| Department at the<br>Fret plant | Light Intensity<br>Level<br>(Lux) | Required Accuracy                 | TLV<br>according to<br>decision No<br>211-2003 |
|---------------------------------|-----------------------------------|-----------------------------------|--|
| Supervisors' room               | 325.0                             |                                   | 538.0  |
| Preparation                     | 3607.0                            | Tasks require accuracy in details |  |
| Control room                    | 816.0                             |                                   | (10)5  |

<sup>\*</sup>The levels of light intensity must not be less than the permissible limit according to table No 6 of the decision of Minister of Manpower and Immigration No 211-2003

As clear from the table that the lighting levels were higher than the permissible limit. So, it is safe and no health effects are expected in these departments.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة · وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

d. Total and Respirable airborne particulates at indoor work environment of different

| Departments of Fret Plant   | Concentration of Total and Respirable<br>Particulates (mg/m <sup>3</sup> ) |       |  |  |
|---|--|-------|--|--|
|   | TSP  | RSP . |  |  |
| Supervisors' room   | 0.6  | ND**  |  |  |
| Preparation   | 1.0  | ND**  |  |  |
| Control room  | 0.5  | ND**  |  |  |
| Maximum Permissible Level<br>According to Law No.4, 1994<br>amended by Law No. 9-2009 | 10.00  | 3.00  |  |  |

<sup>\*</sup> Permissible limits of equivalent noise level according to annex 8 of the Executive regulations No 1095-2011 and 710-2012 of the Egyptian Environmental law No 4-1994 amended by law No 9-2009

\*\* The measured levels were lower than the lower detectable limit of the method

According to the Egyptian Environmental Law No. 4 for 1994 amended by Law No. 9-2009 and the Annex 8 of its Executive law No 1095-2011, all levels of total and respirable particulate matter were below the Threshold Limit Values (TLVs) and do not cause any occupational adverse health effects for the exposed workers.







قسمالصحة المهنية وتنوث الهواء المعهد العالي للصحة العامة وحدة بحوث وبراسات الصحة المهنية وتلوث الهواء

# 2. Stack Particulate Emission Evaluation

### 2.1. Concentrations of particulate in the exhaust emission from stacks

| Stack Location   | Particulates' Concentrations (mg/m³) |
|--|--------------------------------------|
| Furnace (Automizer)  | 37.2                                 |
| Preparation 1  | 35.8                                 |
| Preparation 2  | 45.4                                 |
| Preparation 3  | 32.3                                 |
| Preparation 4  | 31.5                                 |
| Fret   | 25.8                                 |
| Permissible Emission Levels According to Law No. 4,<br>1994 amended by the Law No 9-2009 | 50.0                                 |

As shown in the table, all concentrations of particulates were much lower than the recommended emission levels in the Egyptian Environmental law No 4 -1994amended by law No. 9-2009 and the executive law of the Prime Minister decisions No. 1095-2011 & 710-2012. Therefore, the emission levels are safe and no public or environmental effects are expected.





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

# 2.2. Concentrations of Pollutants in the exhaust emission from stacks of the Sanitary plant in mg/m3 of the Exhaust

|   | Pollutant Concentration (mg/m³) |       |                 |                 |                 | Combustion     |
|---|---------------------------------|-------|-----------------|-----------------|-----------------|----------------|
| Stack Location  | Suspended<br>Particulates       | СО    | SO <sub>2</sub> | NO <sub>2</sub> | CO <sub>2</sub> | Efficiency (%) |
| Stack of oven (1)   | 12.5                            | 72.0  |                 | 45.2            | 5.2             | 97.5           |
| Stack of oven (2)   | 15.8                            | 71.0  |                 | 48.5            | 5.2             | 96.3           |
| Stack of oven (3)   | 10.2                            | 137.0 |                 | 26.6            | 5.2             | 96.1           |
| Stack of oven (4)   | 17.6                            | 125.0 |                 | 25.8            | 5.2             | 95.4           |
| Stack of oven (5)   | 16.4                            | 100.0 |                 | 37.1            | 5.2             | 97.8           |
| Stack of oven (6)   | 22.7                            | 98.0  |                 | 35.8            | 5.2             | 97.6           |
| Stack of oven (8)   | 21.6                            | 89.0  |                 | 28.3            | 5.2             | 95.7           |
| Permissible Emission<br>Levels According to<br>Egyptian<br>Environmental Law<br>No. 4, 1994 | 50.0                            | 150.0 | 400.0           | 600.0           | -               | -              |

As shown in table, all concentration of pollutants were much lower than the recommended emission limits in the Egyptian law No 4-1994 amended by law No. 9-2009 and the executive law of the Prime Minister decision No. 710-2012. Hence, they do not constitute any environmental danger.







قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

2.3. Concentrations of Pollutants in the exhaust emission from stacks of the Tile and Fret plants in mg/m3 of the Exhaust

| Stack Location |  | Pollutant Concentration (mg/m³) |       |                 |                 | CO <sub>2</sub> | Combustion     |
|----------------|--|---------------------------------|-------|-----------------|-----------------|-----------------|----------------|
| )              | Stack Location   | Smoke                           | CO    | SO <sub>2</sub> | NO <sub>2</sub> | (%)             | Efficiency (%) |
|                | Stack of oven (1)  | 23.3                            | 28.7  | '               | 63.2            | 5.2             | 95.3           |
|                | Stack of oven (2)  | 21.5                            | 28.4  | No. 100         | 55.6            | 5.2             | 95.5           |
| Tra            | Stack of oven (3)  | 25.4                            | 37.6  |                 | 55.3            | 5.2             | 98.4           |
| T2             | Stack of oven (4)  | 34.8                            | 42.8  |                 | 52.6            | 5,2             | 85.6           |
|                | Stack of oven (5)  | 27.7                            | 35.3  |                 | 53.3            | 5.2             | 94.2           |
|                | Stack of oven (6)  | 26.8                            | 28.5  |                 | 57.2            | 5.2             | 93.8           |
|                | Stack of oven (1)  | 22.1                            | 23.3  |                 | 59.6            | 5.2             | 95.2           |
|                | Stack of oven (2)  | 21.6                            | 27.8  |                 | 51.4            | 5.2             | 94.6           |
|                | Stack of oven (3)  | 26.7                            | 26.4  |                 | 48.6            | 5.2             | 93.1           |
| 75.4           | Stack of oven (4)  | 28.3                            | 25.4  |                 | 53.7            | 5.2             | 96.4           |
| T4             | Stack of oven (5)  | 27.9                            | 27.6  |                 | 46.1            | 5.2             | 95.3           |
|                | Stack of oven (6)<br>(Stack-4 fire)  | 22.8                            | 18.6  |                 | 40.2            | 5.2             | 97.4           |
| ľ              | Stack of oven (7)  |                                 |       |                 |                 |                 |                |
|                | Stack of oven (8)  | Not working                     |       |                 |                 |                 |                |
| ſ              | Stack of oven (9)  |                                 |       |                 | 3000            |                 |                |
|                | Stack of oven (2)  | 33.2                            | 25.3  |                 | 41.6            | 5.2             | 81.9           |
|                | Stack of oven (3)  | 31.1                            | 21.7  |                 | 37.3            | 5.2             | 68.7           |
| Fret           | Stack of oven (4)  | 26.5                            | 26.8  |                 | 39.7            | 5.2             | 61.5           |
|                | Stack of oven (5)  | 35.3                            | 23.5  |                 | 29.8            | 5.2             | 76.6           |
|                | Stack of oven (6)  | 36.2                            | 25.8  |                 | 33.4            | 5.2             | 84.4           |
| Acc            | sible Emission Levels<br>ording to Egyptian<br>onmental Law No. 4,<br>1994 | 50.0                            | 150.0 | 400.0           | 600.0           | -               | -              |

As shown in the table, all concentration of the emitted pollutants were much lower than the recommended emission limits in the Egyptian law No 4-1994 amended by law No. 9-2009 and the executive law of the Prime Minister decision No. 710-2012 and do not constitute any environmental danger. This may be due to use of natural gas that is cleaner than other types of fuel. CO<sub>2</sub> percentages are within normal range of natural gas combustion. It is worthy noting that there is no limit of CO<sub>2</sub> emissions in Egyptian environmental low.





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

# 3. AMBIENT AIR POLLUTION

Four sampling stations were selected representing the four main directions around the LisicoMisr Company for assessment effect of the company on the surrounding atmosphere. The levels of TSP in  $\mu g/m^3$  and noise level in decibel (db) are also illustrated in the same table.

## 3.1. Concentrations of TSP in the ambient air around LisicoMisr Company

| Station No.  | Location  | Average TSP (µg/m³)            |               |  |
|--|---|--------------------------------|---------------|--|
|  |   | 31/5/2016                      | 1/6/2016      |  |
| 1  | In front of the sanitary<br>department next to<br>EzbetZaaghloul (South)                  | 154.3                          | 155.5         |  |
| 2  | In front of Crusher and tile<br>production and Fret plant next<br>to EzbetKhorshed (East) | 168.2                          | 153.6         |  |
| 3  | Behind Sanitary plant next to<br>EzbetRahma (West)  | 143.2                          | 163.2         |  |
| In front of industrial waste treatment plant next to EzbetKhorshed (North) |   | 174.1                          | 171.7         |  |
|  | d Outdoor Daily Concentration to<br>994amended by Law No 9-2009                           | 230 ( $\mu$ g/m <sup>3</sup> d | aily average) |  |

By comparing the results of total suspended particulates in ambient air with the maximum allowable limits according to annex No. 5 form the executive rule of the Prime Minister decision No. 1095-2011 of Environment low No. 4 – 1994 amended by Law No. 9-2009 (average daily concentration 230  $\mu$ g/m³). Itwas found that all the concentrations were less than these limit. So it is safe.

E-mail: niosh hiph@yahoo.com





قسمالصحة المهنية وتلوث الهواء المعهد العالي للصحة العامة وحدة بحوث ودراسات الصحة المهنية وتلوث الهواء

# 3.2. A-weighted Equivalent Noise levels in the ambient air around LisicoMisr Company

| Station No             | Station Location                               | Equivalent ambient noise<br>level (dB) |
|------------------------|--|--|
| 1                      | El-Rahma Street "West"                         | 60.3                                   |
| 2                      | El-Rahmafarm"North"                            | 62.5                                   |
| 3                      | Zagloul Farm "South"                           | 64.4                                   |
| 4 Khorshed Farm "East" |  | 63.8                                   |
| Recommended O          | utdoor Daily Concentration to law<br>No.9-2009 | 65.0                                   |

According to the Annex No 5 of the executive law of the Prime Minister's decisions No. 1095-2011& 710-2012 of the Egyptian Environmental Law No 4-1994 amended by Law No 9-2009, the A-weighted equivalent noise levels in ambient air were not exceeded.

Reviewed by

Prepared by

Dr. Fadia Ahmed El-Marakby

Dr. Gehan Raafat Mohamed

Prof. Dr. Bahmy Charl Fahmy

Toliand

Move

31812016

E-mail: niosh hiph@yahoo.com